




Karnataka State Fire And Emergency Services Department

Office of the District fire officer
Karnataka state fire and Emergency Services
Raichur Fire station, Raichur-584102,



C.NO:140/FAC/DFO/RCR/2026

Date:11/09/2026

"Fire Advice Certificate"

ANNEXURE-I

Group-B Educational Building

"B1 And B2- Schools Up to Senior Secondary Level and other institutions"
NBC-2016, Part-4, Table 7 (11) 3. 1. 3 Group-B Educational Buildings

To,

The Authorized Signatory,
The Secretary
SVS Oxford Central School
Opp. Vijay Hotel, SVS Colony Raichur Road Manvi
Taluk.Manvi, Dist.Raichur-584123.

Sir/Madam,

Sub:-Issue of "Fire Advice Certificate" to SVS Educational and Charitable Trust @ Manvi
Constructed Low Rise School Building SVS Oxford Central School, Opp. Vijay
Hotel, SVS Colony Raichur Road Manvi, Taluk.Manvi, Dist.Raichur-584123.

Ref : 1. Applicant Request Letter on Dated:04/09/2026.
2. C.NO:17/FSO/Manvi/2026, Date:07/09/2026.


With reference to the subject above cited, the premises of to SVS Educational and Charitable Trust @ Manvi Constructed Low Rise School Building SVS Oxford Central School, Opp. Vijay Hotel, SVS Colony Raichur Road Manvi, Taluk.Manvi, Dist.Raichur-584123. was inspected by Fire Station Manvi on Date: 07/09/2026 with respect to fire prevention, fire fighting and evacuation measures to be complied premises and Submitted building details as under.

A. Details of the Building/Premises:-

01.	Name and Address of the applicant.	:	The Secretary SVS Oxford Central School Opp. Vijay Hotel, SVS Colony Raichur Road Manvi Taluk.Manvi, Dist.Raichur-584123.
02.	Name and Address of the premises.	:	SVS Oxford Central School Opp. Vijay Hotel, SVS Colony Raichur Road Manvi Taluk.Manvi, Dist.Raichur-584123.
03.	Name and Address of the Building owner.	:	Smt.Anusha M W/o.M Anjan Reddy, At.K.Gudadinni Camp Manvi, Taluk.Manvi , Dist.Raichur-584123
04.	Number of Buildings	:	01 No Building.
05.	Number of floors	:	Ground Floor + First floor.
06.	Floor-wise details of occupancy :-		
	Ground Floor	:	1).Class Room-08 No's, 2).Staff Room-01 No, 3).Admin Block-02 No's. 4).Store Room-01 No, 5).Computer Lab Room-01 No.

M. Anusha

MANAGER
SVS OXFORD CENTRAL SCHOOL
Opp: Vijay Hotel, SVS Colony,
Raichur Road, MANVI-584123

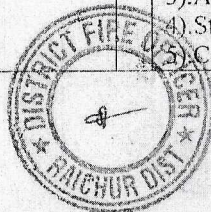

[Signature]

PRINCIPAL
SVS OXFORD CENTRAL SCHOOL
Opp: Vijay Hotel, SVS Colony,
Raichur Road, MANVI-584123

	First Floor	1).Class Room-06 No's. 2).Library-01 No. 3).Lab-03 No's.
07	Height of the building	: 8.35 Mtrs.
08	Site area	: 9307.769 Sq.Mtrs.
09	Built-up area of each floor :-	
	Ground Floor	: 768.195 Sq.Mtrs.
	First Floor	: 768.195 Sq.Mtrs.
	Built-up area	: 1536.39 Sq.Mtr.
11.	Surrounding properties:-	
	East(Side)	: Open Land
	West(Side)	: Road
	North (Front)	: 9.00 Mtrs. Road
	South(Rear)	: Others Residential House.
12.	Set back area available around the Building:-	
	East(Side)	: 8.15 Mtrs.
	West(Side)	: 1.50 Mtrs.
	North (Front)	: 1.00 Mtrs.
	South(Rear)	: 03.90 Mtrs
		Recommended: To provide as per Local Zonal Regulations.

B. On inspection of this Institutional premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl.No [01]	Details [02]	Existing [03]	Recommendations [04]
01	Accessibility to Premises.	The premises are accessible from 09.00 Mtrs. Wide Road On Northern Side and the Road is hardened to carry the weight of 45,000 kgs.	Adequate.
02	No of entrances.	02 No's. Width 1). 5.50 Mtrs. 2).1.23 Mtrs.	-----
03	No. of staircases available	No of staircase : 02 No's.	-----
		Width of staircase : 1.30 Mtr. 1.30 Mtr.	
		Width of treads : 30 CM 30 CM	
		Height of risers : 08 CM 08 CM	
		No of riser per flight : 16 No's. 16 No's.	
		Height of handrails : 0.90 Mtrs 0.90 Mtrs	
Head room clearance : --- --			
04	Portable Fire Extinguisher	Not Provided	Recommended to Provided:- Extinguishers as below mentioned 1).One ABC Type fire extinguisher each of 6 kg capacity For Every 100 m2. 2).One CO2 Fire Extinguisher of 4.5 kg Capacity shall be Provided near electrical Panel Board. [All the extinguishers suggested above should be with B.I. S markings and should be located at an easily accessible position without obstructing

M. Anisha

MANAGER

SVS OXFORD CENTRAL SCHOOL
Opp: Vijay Hotel, SVS Colony,
Raichur Road, **MANVI-584123**



[Signature]

PRINCIPAL
SVS OXFORD CENTRAL SCHOOL
Opp: Vijay Hotel, SVS Colony,
Raichur Road, **MANVI-584123**

			located at an easily accessible position without obstructing the normal passage and maintained periodically].
05	Escape routes	Not Marked.	Recommended To Provide Direction in which the students have to move in the event of an emergency should be displayed in the corridor in each floor during evacuation.
06	Fire order (Fire Safety Plans)	Not Displayed	Recommended To Provide The Notice board have been indicted the action should be taken by the employees in case of any emergency should be displayed with the telephone number of Manvi Fire Station- i.e-08538-220362 and the telephone number of nearest Ambulance services and Police Station..
07	No Smoking Board	Not Displayed	Recommended To Provide As per sec-4 of COPTA a board with words NO SMOKING AREA shall be written in English & Kannada both language shall be prominently displayed at inside the entry /exit of the each floor.
08	Fire Siren	Not Installed	A Fire Siren shall installed in the premises to inform the inmates in case of a fire emergency and evacuate the area.
09	Nominate Fire Fighting Training	Not Imparted	At-least 40% of School Staff should be got trained in basic fire fighting at R.A.Mundkur fire & Emergency Services Academy, Bannerughatta road, Bangalore within 3 months or at an early date.
10	Fire Precautionary Measures:- A. Explosive and Flammable Materials Should Not be Stored in the Store Room, UPS Room Electrical Panel Area, Class Rooms, Laboratory And Electrical Some Panel Premises. B. Accumulation of combustible Waste in and around the premises should be avoided. C. The Exit Ways Shall be always Kept Clear Without any obstruction. D. Liquefied Petroleum Gas Should Not be Stored in the building. E. The doors shall not kept Locked/ Latched during working hours and shall be free from obstruction. F. During the class hours in the class room doors shall not be locked from inside to outside. G. As per Honorable Supreme Court Order All Teachers and staffs Shall be trained to handle Safety Equipment, initiate Emergency Evacuation and Protect Their Students H. in the event of Fire and other Emergency and the school shall observe the Fire Safety Day on April 14th of Every Year by Conducting Fire Safety Drills with Co-ordinate with fire service Department.		

Under the Circumstance stated above, there is No Objection to run Education activities in **SVS Educational and Charitable Trust @ Manvi, Constructed Low Rise School Building SVS Oxford Central School, Opp. Vijay Hotel, SVS Colony Raichur Road Manvi, Taluk.Manvi, Dist.Raichur-584123.** School Building subject to the Condition of providing Additional Fire Fighting Equipments and Fire precautionary measures shown in Part-B. Therefore management should compulsory Karnataka Fire And Emergency Services Department conditions to provide Additional Equipments And Then Intimate to the office Within 90 days Positively Without Fail. **This Fire Advice Certificate Valid for Only One Year From The date of issue and renewable without fail**.

All Requirements Recommended above are as per National Building Code-2016 Part-4 Clause3.1.3 of Fire And Life Safety Will have to be complied With Mandatorily.

School U-DISE Code:-29060718714

M. Anusha
MANAGER
SVS OXFORD CENTRAL SCHOOL
Opp: Vijay Hotel, SVS Colony,
Raichur Road, **MANVI-584123**

PRINCIPAL
SVS OXFORD CENTRAL SCHOOL
Opp: Vijay Hotel, SVS Colony,
Raichur Road, **MANVI-584123**

SVS OXFORD CENTRAL SCHOOL
Opp: Vijay Hotel, SVS Colony,
Raichur Road, **MANVI-584123**

Copy To,
1. The D.G.P. KSF&ES -
Banglore.
2. Fire Station Officer
Manvi.

M. Anurag

MANAGER
SVS OXFORD CENTRAL SCHOOL
Opp: Vijay Hotel, SVS Colony,
Raichur Road, **MANVI-584123**

[Signature]

PRINCIPAL
SVS OXFORD CENTRAL SCHOOL
Opp: Vijay Hotel, SVS Colony,
Raichur Road, **MANVI-584123**